# Lateral Plungers • with thread, without seal, with female thread

22150.1354



## **Product Description**

To be used for positioning and applying pressure, e.g. during painting and sandblasting.

#### **Material**

#### Body

· Steel, zinc-plated

#### Threaded washer

· Steel, blackened

## Spring

Stainless steel

#### **Assembly**

Formula for calculating the center distance for the mounting hole:

 $I_0 = z/2 + w + x$ 

 $I_0$  = center distance,

y = workpiece height,

w = workpiece length,

x = stroke

z = stop diameter

Calculation dimension x for workpieces:

 $x = d_2/2 - s$ 

Lateral plungers are installed by screwing in by means of a mounting tool.

#### Characteristic


Version light spring load = spring from stainless steel


#### More information

#### **Notes**

Individual set screws can be screwed in the plate with threaded hole.

## **Drawing**

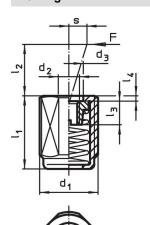

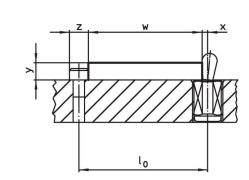



Halder, Inc. www.halderusa.com

#### **Order information**


	Dimensions	Spring load	Dimensions					Stroke	ws	<u>A</u>	I	Art. No.	
	d <sub>1</sub>	l <sub>1</sub> -2	F max. <sup>1)</sup>	d <sub>2</sub>	d <sub>3</sub>	l <sub>2</sub>	l <sub>3</sub>	I <sub>4</sub>	s		max.	•	
	[mm]	I	[N]		I	[mm]	ı	1	[mm]	[mm]	[°C]	[g]	
Light spring load													
	M18 x 1,5	31.5	100	M6	10.1	16.7	7.5	1.5	1.6	16	250	23	22150.1354

<sup>1)</sup> statistical average value

# Accessories

assembly tool	Dimensions d <sub>1</sub> [mm]	[9]	Art. No.
	M18 x 1,5	137	22150.0822

# **Application example**

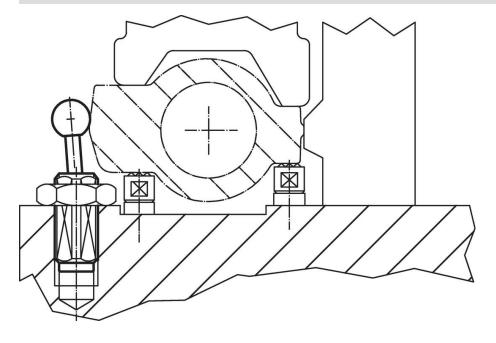

# Compliance

# **RoHS** compliant

Contains lead - compliant according to exceptions 6a / 6b / 6c.

# Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 23.01.2024.

# **Contains Proposition 65 substances**



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

Halder, Inc.

## **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halderusa.com Page 2 of 2
Published on: 28.4.2024