# **Spring Push Plungers •** with mounting flange, horizontal 22170.1015



## **Product Description**

The spring push plungers are used for simple and secure positioning of workpieces or components on stops and support points.

The spring push plunger is designed with a thrust pad that can be rotated  $4 \times 90^{\circ}$  depending on the application.

Below  $h_2$ , a pull-down effect is created when the thrust pad is installed in the appropriate position.

#### Material

#### Λ -

#### Body

 Zinc die-cast, plastic coated, black, similar to RAL 9005, matt structure

#### **Thrust Pad**

· Stainless steel 1.4542

#### Screw

· Stainless steel A2


## **Spring**

• Stainless steel 1.4310

### Assembly

Assembly by means of washers ISO 7092.

# Drawing

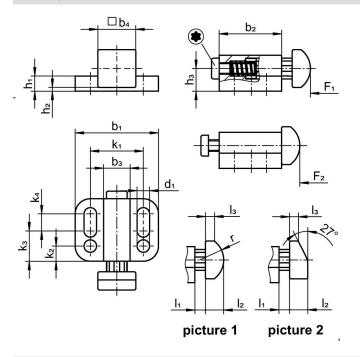

## **Order information**

	Dimensions															<b>(1)</b>	Spring load <sup>1)</sup>		I	Art. No.
b <sub>1</sub>	d <sub>1</sub>	b <sub>2</sub>	<b>b</b> <sub>3</sub>	b <sub>4</sub>		h <sub>2</sub> h <sub>3</sub>	k <sub>1</sub>	k <sub>2</sub>	k <sub>3</sub>	<b>k</b> <sub>4</sub>	I <sub>1</sub>	l <sub>2</sub>	I <sub>3</sub>	r			F <sub>1</sub>	F <sub>2</sub>		
	[mm]																[N]		[g]	
plung	plunger rounded, heavy spring load – picture 1, Stainless steel																			
39	6.5	35	14.5	22	6	1 12	27	6.5	15	13.5	8.2	10	4.7	13.75	8.2	30	27	75	96	22170.1015

<sup>1)</sup> statistical average value

www.halderusa.com Page 1 of 2
Published on: 12.8.2024

Halder, Inc.

# Compliance

# **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

## Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 27.06.2024.

#### Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

#### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



Halder, Inc.

www.halderusa.com Page 2 of 2

Published on: 12.8.2024