# Ball Lock Pins · self-locking, with safety handle

# 22350.1076



### **Product Description**

For quick fastening, locking, adjusting, changing and securing. Quickly and easily unlockable for frequently repeated connections.

All versions are corrosion resistant. When using stainless steel 1.4542: high-strength, hardened, abrasion resistant pin with high load capacity.

Robust safety handle (press button not overlaying). Shape of grip protects from unintentional use of the press button.

#### Material

#### Pin part

· Stainless steel 1.4542, precipitationhardened

### Handle

· Stainless steel

### **Press button**

· Stainless steel

#### **Spring**

· Stainless steel

### **Operation**

The balls are unlocked by pressing the button.

#### Characteristic

Types from stainless steel 1.4542 with marking below the balls.

#### More information

#### **Notes**

Customized design on request.

### **Accessories**

Can easily be fitted with retaining cable EH 22400.

#### **Further products**

- · Locating Bushings, for ball lock pins and socket pins
- Locating Bushings, with flange, for ball lock pins and socket pins
- **Retaining Cables**
- Positioning Bushings, with collar, DIN 172 A
- Positioning Bushings, without collar, DIN

# **Drawing**



<sup>\*\*</sup> Types from stainless steel 1.4542 with marking

### **Order information**


<b>d</b> <sub>1</sub>	0.04 +0.6 ±1								max.	i	Shearing resistance, two-shear <sup>1)</sup> min.	Art. No.
-0.08								[mm]	[°C]	[9]	[kN]	
12	80	14.5	16.5	28	10.6	23.1	33.5	12	250	124	144	22350.1076

<sup>1)</sup> Shearing resistance similar to DIN 50141

Halder, Inc.

www.halderusa.com Page 1 of 2 Published on: 17.11.2024

# **Application example**

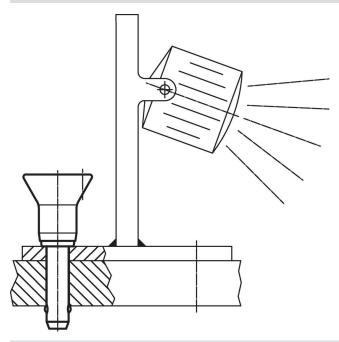

# Compliance

### **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 27.06.2024.

Halder, Inc.

### Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halderusa.com Page 2 of 2

Published on: 17.11.2024